

# SERVICE BULLETIN

## CAB SERVICE & PARTS CORPORATION

#1

SUBSIDIARY OF  
CHECKER MOTORS  
CORPORATION

NEW YORK \* BROOKLINE  
CHICAGO \* DETROIT


November 18, 1958

Subject: ELECTRICAL - MODEL A-9

Description: READING LAMPS

To prevent unnecessary loss of passenger and driver compartment reading light doors, the following procedure is recommended:

1. Drill a 1/16" hole through plastic door and into metal lamp housing at both ends.
2. Insert #4 (3/4" long) sheet metal screws.
3. Remove and replace screws whenever bulb replacement is required.

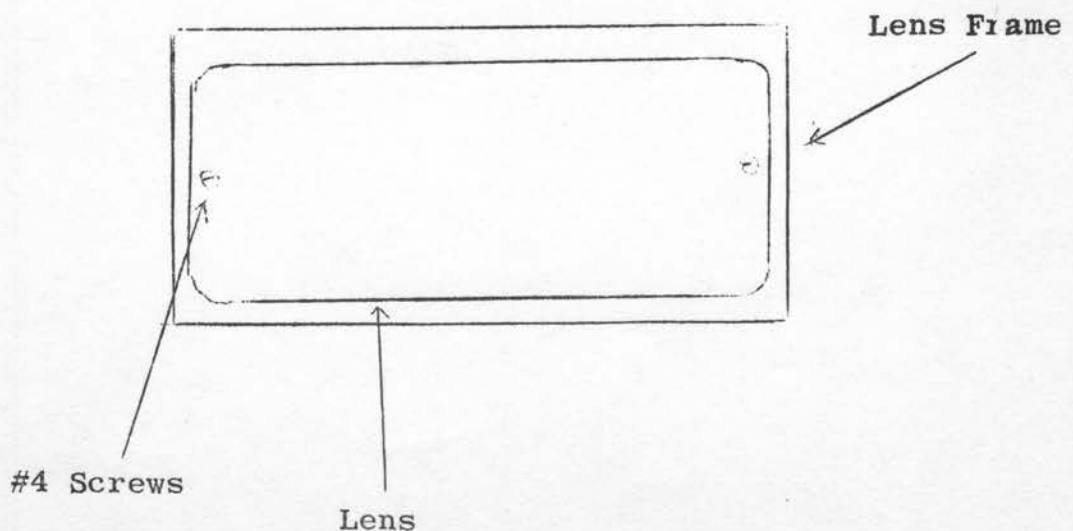

By: NEW YORK SERVICE DEPARTMENT